


X23

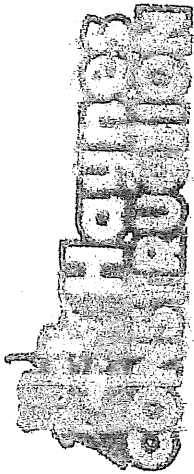

3130 St. Rte. 18
Norwalk, Ohio, 44137

419-669-2457

REPAIR ORDER

QTY	PART NO.	DESCRIPTION	EST. AMOUNT
6	2118-30260	Thrust washer	By photo
3	9325-08010	Spring pins	By photo
1	10E14552875	Big lower bearing in swing gear case	
1	10E14558124	Bearing (Top smaller one)	
1		Thrust Ring	
1	10E14552876	Seal	
1	10E14552874	Ring (Lower Tin)	
1	10E14528725	Planet Carrier Assy. (Full One)	
1	SA7118-30490	Sun Gear for Little plane Carrier	
1	14537876	Gear Case	

Rebuilt swing gear box


TIME PROPOSED	DATE	AM	PM
10:00	5/5/70		
MAKE	MODEL	YEAR	
Volvo	ECR235CL	1969	
ENGINE	TRANSMISSION	NATION NO.	
5788			

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purpose of testing, inspection or delivery at my risk. An express mechanic's Lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Signed

X23 23 hr 70 go

41969-2457

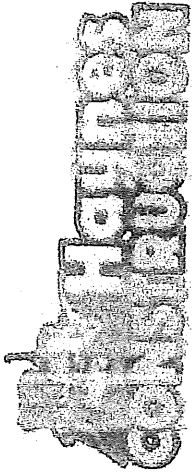

CHANDLER


[illegible]

TIME FORWARDED	DATE	TIME P.M.	☐
TO FBI	DATE	TIME P.M.	☐
MODEL	DATE	TIME P.M.	☐
LICENSE	DATE	TIME P.M.	☐
PL. NO.	DATE	TIME P.M.	☐

I hereby authorize the above agent to work to be done along with necessary materials, toll and your employees may operate above vehicle for purposes of testing, inspection or delivery at my place. An express Mechanical Lien is acknowledged on above vehicle to secure the amount of repairs thereto. This will not be held responsible for loss or damages to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

ଉତ୍ତରାଘାଟ

Greenville, Ohio, 44835

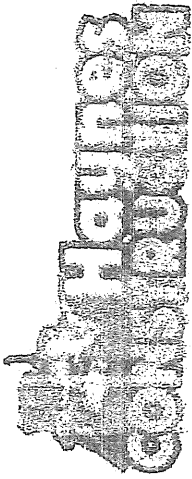

THE AIR OPERATOR

300 HR Service

QTY	PART NO.	DESCRIPTION	UNIT	AMOUNT
1	1820	oil		
1	3690	Fuel		
1	3683	Fuel		
1	2330	air		
1	2816	air		

TIME	DATE	TIME	DATE
07:00	11/16/14	08:00	11/16/14
FROM	TO	FROM	TO
WV	MD	WV	MD
NAME	NAME	NAME	NAME
JACKSON	JACKSON	JACKSON	JACKSON
ADDRESS	ADDRESS	ADDRESS	ADDRESS
12345	12345	12345	12345
CITY	CITY	CITY	CITY
STATE	STATE	STATE	STATE
ZIP	ZIP	ZIP	ZIP
12345	12345	12345	12345
PHONE	PHONE	PHONE	PHONE
123-4567	123-4567	123-4567	123-4567
FAX	FAX	FAX	FAX
SIGNATURE	SIGNATURE	SIGNATURE	SIGNATURE
[Signature]	[Signature]	[Signature]	[Signature]
PRINT NAME	PRINT NAME	PRINT NAME	PRINT NAME
JACKSON	JACKSON	JACKSON	JACKSON
TITLE	TITLE	TITLE	TITLE
OWNER	OWNER	OWNER	OWNER
MANAGER	MANAGER	MANAGER	MANAGER
SALES	SALES	SALES	SALES
SERVICE	SERVICE	SERVICE	SERVICE
REPAIRS	REPAIRS	REPAIRS	REPAIRS
OTHER	OTHER	OTHER	OTHER
DATE OF BIRTH	DATE OF BIRTH	DATE OF BIRTH	DATE OF BIRTH
11/16/14	11/16/14	11/16/14	11/16/14
SEX	SEX	SEX	SEX
M	M	M	M
RACE	RACE	RACE	RACE
W	W	W	W
HIGHEST GRADE	HIGHEST GRADE	HIGHEST GRADE	HIGHEST GRADE
HS	HS	HS	HS
COLLEGE	COLLEGE	COLLEGE	COLLEGE
UNIVERSITY	UNIVERSITY	UNIVERSITY	UNIVERSITY
MAJOR	MAJOR	MAJOR	MAJOR
BUSINESS	BUSINESS	BUSINESS	BUSINESS
EDUCATION	EDUCATION	EDUCATION	EDUCATION
12345	12345	12345	12345
EXPIRATION DATE	EXPIRATION DATE	EXPIRATION DATE	EXPIRATION DATE
11/16/14	11/16/14	11/16/14	11/16/14
ISSUING AGENCY	ISSUING AGENCY	ISSUING AGENCY	ISSUING AGENCY
STATE	STATE	STATE	STATE
12345	12345	12345	12345
AGENCY ADDRESS	AGENCY ADDRESS	AGENCY ADDRESS	AGENCY ADDRESS
12345	12345	12345	12345
AGENCY CITY	AGENCY CITY	AGENCY CITY	AGENCY CITY
12345	12345	12345	12345
AGENCY STATE	AGENCY STATE	AGENCY STATE	AGENCY STATE
12345	12345	12345	12345
AGENCY ZIP	AGENCY ZIP	AGENCY ZIP	AGENCY ZIP
12345	12345	12345	12345
AGENCY PHONE	AGENCY PHONE	AGENCY PHONE	AGENCY PHONE
123-4567	123-4567	123-4567	123-4567
AGENCY FAX	AGENCY FAX	AGENCY FAX	AGENCY FAX
AGENCY WEBSITE	AGENCY WEBSITE	AGENCY WEBSITE	AGENCY WEBSITE
AGENCY COMMENTS	AGENCY COMMENTS	AGENCY COMMENTS	AGENCY COMMENTS
AGENCY NOTES	AGENCY NOTES	AGENCY NOTES	AGENCY NOTES

I hereby authorize you above repair work to be done jointly with necessary materials. You and your employees may operate above vehicle for purpose of testing, inspection or electrolysis at my risk. An express disclaimer of claim is acknowledged on above vehicle to ensure the amount of repair thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

পাউণ্ড

Norwalk, Ohio, 44857

419-663-2457

東山隱士

Serviced, Greased, checked /
changed planetary oil.

TIME Purchased	AM.	☐	PM.	☐
YR.	MAKE	ONE		
MODEL	valvo 4-25-19			
LICENSE	235			
PO. NO.	X23			
SPEEDOMETER		4,780 hrs		

[illegible]

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purpose of testing, inspection or delivery at my risk. An express Mechanic's Lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.



Driver's Vehicle Inspection Report

Check ANY Defective Item and Give Details under "Remarks."

DATE: 1-19-19

TRUCK/TRACTOR NO. X-23

- | | | |
|--|--|---|
| ☐ Air Compressor | ☐ Horn | ☐ Springs |
| ☐ Air Lines | ☐ Lights | ☐ Starter |
| ☐ Battery | Head - Stop | ☐ Steering |
| ☐ Brake Accessories | Tail - Dash | ☐ Tachograph |
| ☐ Brakes | Turn Indicators | ☐ Tires |
| ☐ Carburetor | ☐ Mirrors | ☐ Transmission |
| ☐ Clutch | ☐ Muffler | ☐ Wheels |
| ☐ Defroster | ☐ Oil Pressure | ☒ Windows |
| ☐ Drive Line | ☐ On-Board Recorder | ☐ Windshield Wipers |
| ☐ Engine | ☐ Radiator | ☐ Other |
| ☐ Fifth Wheel | ☐ Rear End | |
| ☐ Front Axle | ☐ Reflectors | |
| ☐ Fuel Tanks | ☐ Safety Equipment | |
| ☐ Heater | Fire Extinguisher | |
| | Flags - Flares - Fuses | |
| | Spare Bulbs & Fuses | |
| | Spare Seal Beam | |

TRAILER(S) NO(S). _____

- | | | |
|--|---------------------------------------|------------------------------------|
| ☐ Brake Connections | ☐ Hitch | ☐ Tarpaulin |
| ☐ Brakes | ☐ Landing Gear | ☐ Tires |
| ☐ Coupling Chains | ☐ Lights - All | ☐ Wheels |
| ☐ Coupling (King) Pin | ☐ Roof | ☐ Other |
| ☐ Doors | ☐ Springs | |

Remarks: both front windows need replaced
Volvo 235

☐ Condition of the above vehicle is satisfactory

Drivers Signature _____

☒ Above Defects Corrected

☐ Above Defects need NOT Be Corrected For Safe Operation of Vehicle

Mechanic's Signature _____ Date _____

Driver's Signature _____ Date _____

Norwalk, Ohio, 44857

410-33-2457

國立中央圖書館

replaced windshield and tint windows


TIME	DATE	AM	☐	PM	☐
12	10/10				
RECEIVED	235				
URGENT					
URGENT					
NO. 10					

[illegible]

It hardly requires the above report to be believed along with necessary materials. You and your employees may operate under various circumstances of working, inspection or delivery of my right. An employee Mecklenburg's them is recommended on above vehicle to ensure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles laid in vehicle in case of fire, theft, accident or any other cause beyond your control.

control.

44-1986-2457

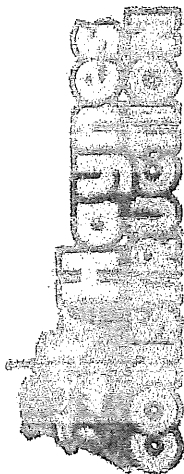

國立中央圖書館

Changed Poor facthe's

changed picture

f: y-z | acv vcll ✓

Service

QTY	PART NO.	DESCRIPTION	SALE AMOUNT
1	VD E 14572001	peer	
		hach	
1	VD E 14572000	peer	
		hach	
1	1820	oil filter	
1	1664	H70 filter	
1	3683	fuel filter	
1	2816	ignition filter	
1	2330	order air filter	
1	3690	fuel filter	

A hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purpose of testing, inspection or delivery at my risk. An express Mechanic's Lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Adam nyz

ney + service - 4635

TIME PACKAGED	AM	☐	PM	☐
YR.	MAKE	DATE		
	VC10	1-3-19		
MODEL	VARIATION BY			
EUR 235 CL	Adam			
LICENSE	ACTION NO.			
	X23			
POL. NO.	SPECIFICATION			
	4334			

PHILIP CHAMBER

1969-2457

QTY	PART NO.	DESCRIPTION	AMOUNT
1	14570746	Front lower left window (Glass)	
1	14539978	Gauge level Fuel Tank	
1	14574289	Water Valve on Heater	
2	9979	Cab Air Filter	
2	14539846	Work light	

REPAIR ORDER

419-069-2457

RECEIVED AM ☐ PM ☐

DATE 11-7-18

TIME 11:00

NO. 235

ISSUED BY [Signature]

EXT. NO. 423

4/54

For Heater

Welded and on Hyd fill plug, checked

for bolts out, replace water valve on heater

light on top of Cab & light on right side of beam, replaced both cab filter

I hereby authorize the above repair work to be done along with a necessary material. You and your employees may operate above vehicle for purpose of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repair. Made this 11th day of Nov 1918.

[illegible]



Driver's Vehicle Inspection Report

Check ANY Defective Item and Give Details under "Remarks."

DATE: 10-1-18

TRUCK/TRACTOR NO. X-23

- | | | |
|--|--|--|
| ☐ Air Compressor | ☐ Horn | ☐ Springs |
| ☐ Air Lines | ☐ Lights | ☐ Starter |
| ☐ Battery | Head – Stop | ☐ Steering |
| ☐ Brake Accessories | Tail – Dash | ☐ Tachograph |
| ☐ Brakes | Turn Indicators | ☐ Tires |
| ☐ Carburetor | ☐ Mirrors | ☐ Transmission |
| ☐ Clutch | ☐ Muffler | ☐ Wheels |
| ☐ Defroster | ☐ Oil Pressure | ☐ Windows |
| ☐ Drive Line | ☐ On-Board Recorder | ☐ Windshield Wipers |
| ☐ Engine | ☐ Radiator | ☐ Other |
| ☐ Fifth Wheel | ☐ Rear End | |
| ☐ Front Axle | ☐ Reflectors | |
| ☐ Fuel Tanks | ☐ Safety Equipment | |
| ☐ Heater | Fire Extinguisher | |
| | Flags – Flares – Fuses | |
| | Spare Bulbs & Fuses | |
| | Spare Seal Beam | |

TRAILER(S) NO(S). _____

- | | | |
|--|---------------------------------------|------------------------------------|
| ☐ Brake Connections | ☐ Hitch | ☐ Tarpaulin |
| ☐ Brakes | ☐ Landing Gear | ☐ Tires |
| ☐ Coupling Chains | ☐ Lights – All | ☐ Wheels |
| ☐ Coupling (King) Pin | ☐ Roof | ☐ Other |
| ☐ Doors | ☐ Springs | |

Remarks: No Heat, Turn table leaking oil

☐ Condition of the above vehicle is satisfactory

☒ Drivers Signature _____


☒ Above Defects Corrected

☒ Above Defects need NOT Be Corrected For Safe Operation of Vehicle

Mechanic's Signature Cep Date 11-8-18

Driver's Signature David Gilkerson Date 10-1-18

No Leaks Found!

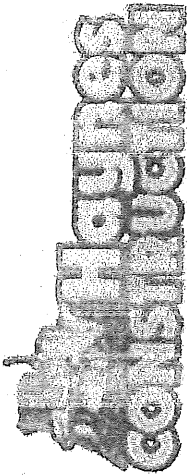

3130 St. Rte. 18

Norwalk, Ohio, 44857

X-23

419-663-2457


REPAIR ORDER

QTY	PART NO.	DESCRIPTION	SALE AMOUNT
1	14725906	hyd. gauge	
1	21928687	Dip stick	
1	14570746	lower window	
1	14570748	upper window	

TIME PROMISED	AM. ☐	PM. ☐
DATE	8-21-18	
YR.	10/10	
MODEL	235	
LICENSE	UNLICENSED	
FO. NO.	MOTOR NO.	
SPEEDOMETER		

Top of Dip stick For oil was Brake Replaced
with new / hydro sight glass was Replaced
with new / lower & upper Front glass was Brake
replaced glass

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express Mechanic's Lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

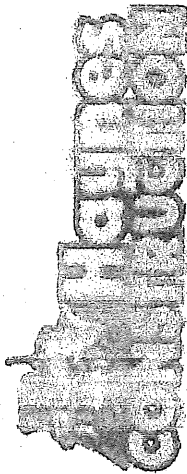

3150 St. Rte. 18

Norwalk, Ohio, 44857

419-668-2457

REPAIR ORDER

X-23


QTY	PART NO.	DESCRIPTION	SALE AMOUNT
1	1820	oil Filter	
1	3890	Fuel Filter	
1	3683	Fuel Filter	
1	2330	outer air	
1	2816	inner air	

TIME PREPARED	DATE	TIME
YR.	MO.	DAY
MODEL	YEAR	MAKE
LICENSE	PLATE	REGISTRATION
PO. NO.	VEHICLE NO.	VEHICLE TYPE

Serviced / Serviced / welded blocks on
stick due to wishbone was hitting quick coupler
hoses / Fixed coolant leak loose clamp /

* Top & Bottom glass needs ordered & replaced

I hereby authorize the above repair work to be
done along with necessary materials. You and
your employees may operate above vehicle
for purpose of testing, inspection or delivery
at my risk. An express mechanic's lien is
acknowledged on above vehicle to secure the
amount of repairs thereto. You will not be
held responsible for loss or damage to vehicle
or articles left in vehicle in case of fire, theft,
accident or any other cause beyond your
control.

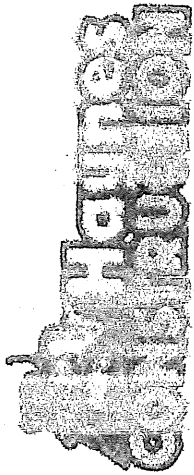

3130 St. Rte. 18

Northwalk, Ohio, 44857

419-669-2457

X-23

REPAIR ORDER

QTY	PART NO.	DESCRIPTION	EST. AMOUNT
1	3683	Fuel Filter	
1	3690	Fuel Filter	
1	1820	oil Filter	
1	2330	oiler air	
1	2816	inlet air	
2	9979	cub air	


DATE RECEIVED	TIME	MAKE	MODEL	YEAR	PLATE NO.
		Volvo	235	6-8-18	Ent

Serviced / Switch coupler due to one bad Bent pin For safety lock / Found sight glass leak & Dipstick Brake

* Needs oil dipstick & hyd. sight glass

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's Lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Signed

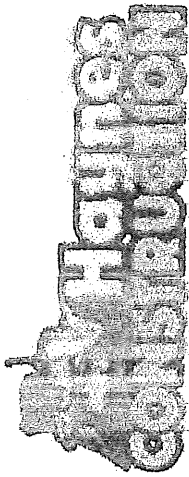

3130 St. Rte. 18

Norwalk, Ohio, 44857

419-669-2457

X23

QTY	PART NO.	DESCRIPTION	PAID AMOUNT
1	38202		
2	38202	spring	
1	70100A50686C	lock	
2	70100A40714		

REPAIR ORDER

TIME PROMISED	DATE	TIME
TH	23	5-7-18
MODEL	X23	WINTER
LICENSE		MOTORING
PO. NO.		SPEEDOMETER

Front safety latch was brake replaced with new ~~old~~ safety latch, also replaced return springs


I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purpose of testing, inspection or delivery at my risk. An Express Mechanic's Lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damages to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Signed

3130 St. Rte. 18

Norwalk, Ohio, 44857

419-668-2457

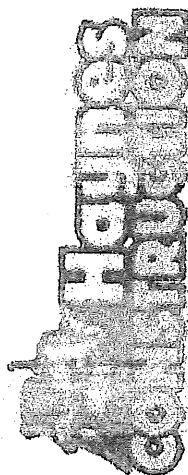

REPAIR ORDER

CITY	PART NO.	DESCRIPTION	SALE AMOUNT
	1 1870	eng oil	
	1 368 3683	fuel	
	1 3690	fuel	
	2 9979	carb air	
	1 14534863	seal kit	

NAME Jake

ADDRESS

CITY

PHONE

INSTRUCTIONS

Serviced
- Put quart and a half
oil in swing motor
- Installed Rebuilt Roto coupler
Rebuilt Roto coupler

TIME PROMISED	AM	PM
DATE	10-5-17	
MAKE	Volvo	
MODEL	ECR235	
LICENSE		
PLATE NO.		
SPECIAL ORDER		

LABOR

TOTAL

OTHER

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purpose of testing, inspection or delivery at my risk. An express Mechanic's Lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

QTS. OIL

Lbs. Grease

Lbs. Gear Lube

Tape, Fluid

Brake Fluid

PARTS

Gas, Oil, Grease

ACCESSORIES

Tires & Rims

BODY SHOP


Outside Repairs

FORWARD

LABOR

Norwalk, Ohio, 44857

419-663-2457

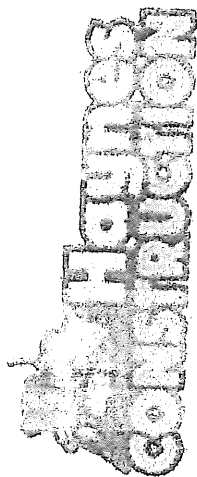

RECEIVED

[illegible]



Driver's Vehicle Inspection Report

Check ANY Defective Item and Give Details under "Remarks."

DATE: 1-6-17

TRUCK/TRACTOR NO. X23

- | | | |
|--|--|--|
| ☐ Air Compressor | ☐ Horn | ☐ Springs |
| ☐ Air Lines | ☐ Lights | ☐ Starter |
| ☐ Battery | Head - Stop | ☐ Steering |
| ☐ Brake Accessories | Tail - Dash | ☐ Tachograph |
| ☐ Brakes | Turn Indicators | ☐ Tires |
| ☐ Carburetor | ☐ Mirrors | ☐ Transmission |
| ☐ Clutch | ☐ Muffler | ☐ Wheels |
| ☐ Defroster | ☐ Oil Pressure | ☐ Windows |
| ☐ Drive Line | ☐ On-Board Recorder | ☐ Windshield Wipers |
| ☒ Engine | ☒ Radiator | ☐ Other |
| ☐ Fifth Wheel | ☐ Rear End | |
| ☐ Front Axle | ☐ Reflectors | |
| ☐ Fuel Tanks | ☐ Safety Equipment | |
| ☐ Heater | Fire Extinguisher | |
| | Flags - Flares - Fuses | |
| | Spare Bulbs & Fuses | |
| | Spare Seal Beam | |

TRAILER(S) NO(S). _____

- | | | |
|--|---------------------------------------|------------------------------------|
| ☐ Brake Connections | ☐ Hitch | ☐ Tarpaulin |
| ☐ Brakes | ☐ Landing Gear | ☐ Tires |
| ☐ Coupling Chains | ☐ Lights - All | ☐ Wheels |
| ☐ Coupling (King) Pin | ☐ Roof | ☐ Other |
| ☐ Doors | ☐ Springs | |

Remarks: Plastic recovery tank on X23 has pin hole,
Orange antifreeze pipping on turbo
Has pretty good eng oil leak.

☐ Condition of the above vehicle is satisfactory

Drivers Signature _____

☒ Above Defects Corrected

☐ Above Defects need NOT Be Corrected For Safe Operation of Vehicle

Mechanic's Signature Ullman

Date _____

Driver's Signature Mike Simmons

Date 1-6-17